

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Estimate #0002271

Date : 4/24/17

Page : Page 1 of 3

Center :

Customer : SHREVEPORT LIMOUSINE

Address : 1200 MARSHALL STREET

City : SHREVEPORT, LA 71101-

Phone 1 : (318) 426-0223

Ext : CELL

Phone 2 : (318) 603-5315

Ext :

Vehicle : 1957 BENT S1

License :

VIN : B288EG

Fleet #:

Engine : 298 CID 6/CYL

Mileage :

Key# :

Trans : 4 SPEED HY

CODE :

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
PDI001	JDP	INSPECT CAR FOR SERVICE AND REPAIRS. ENGINE COMPRESSION CHECK CYL.#1, 135, CYL.#2, 125, CYL.#3, 120, CYL.#4, 120, CYL#5, 120, CYL.#6, 125.	405.00		405.00
BSC009	JDP	REBUILT FRONT UPPER AND LOWER WHEEL CYLINDERS. NECESSARY TO HONE OUT CYLINDERS AND REPLACE BRAKE SHOE SHAKE BACK SPRINGS AS NEEDED. FREE UP SHOE ANGLE ADJUSTERS. AND ADJUST. REPLACE RUBBER DUST COVERS ON BACKING PLATE AS NEEDED.	675.00	464.04	1139.04
	4.00	CD1203	FRONT WHEEL CYL KIT	193.52	
	4.00	UG 2032	SPRING SHAKEBACK	229.96	
	4.00	UG 1169 BRAKES S/C	DUSTCAP, BACKING PLATE	40.56	
BSC021	JDP	REAR WHEEL CYLINDERS, NECESSARY TO CHECK SHAKE BACK STOP SPRINGS, REPLACE IF NEEDED. REBUILD WHEEL CYLINDERS. FREE UP SHOE ANGLE ADJUSTERS & ADJUST	540.00	310.72	850.72
	2.00	UG 2032	SPRING SHAKEBACK	114.98	
	2.00	CD 1204	WHEEL CYLINDER KIT, REAR	155.18	
	4.00	UG 1169 BRAKES S/C	DUSTCAP, BACKING PLATE	40.56	
BSC003	JDP	BRAKE MASTER CYLINDER, UPPER HAS BEEN REPLACED, BUT LOWER NEED TO BE REPLACED TOO. REMOVE AND RE INSTALLED LOWER BRAKE MASTER CYLINDER. NECESSARY TO BLEED COMPLETE SYSTEM. BRAKING SYSTEM.	675.00	996.64	1671.64
	1.00	UG 3848R	MASTER CYLINDER, LOWER	700.00	
	2.00	UR 14202 HYD SYSTEM	HOSE M/CYL	86.96	
	4.00	RR 363L5	BRAKE FLUID 5 LITRE	209.68	
BSC0	JDP	SERVO, NEED TO BE REBUILT, HAS TRANSMISSION FLUID LEAKING OUT OF THE OUTER SPRING PLATE.	810.00	971.08	1781.08
	1.00	UG 3528	SERVO, SPRING DUST C	307.28	
	1.00	UG 4372R BRAKESERVO	LINING, PRESURE PLATE	64.67	
	9.00	UG 3849	RIVET, SERVO LINING	12.06	
	1.00	UG 2140 BRAKE SERVO	SEALING BAND,	22.77	
	1.00	RG 8021	RUBBER STOP, SERVO S	12.80	
	1.00	RG 6640R	SERVO SEAL	33.33	
	1.00	RG 8083	SERVO GEAR 17 TEETH	518.17	
BSC0	JDP	RENEW REAR BRAKE ROD STEADY BUSHING AND PIVOT BUSHINGS.	81.00	51.47	132.47
	4.00	RG 5085 LINKAGE	BUSHING, GROMMETT	26.80	
	1.00	RG 4204	RUBBER BUSH, REAR STEADY	24.67	
	JDP	EMERGENCY BRAKE CABLE, RENEW.	270.00	174.00	444.00
	1.00	UG 1201	HANDBRAKE CABLE	174.00	
TS1002	JDP	INSTALLED NEW SHIFTER LINKAGE BUSHING.	94.50	13.40	107.90
	2.00	RG 5085 LINKAGE	BUSHING, GROMMETT	13.40	
TS10	JDP	TRANS FLUID SERVICE	202.50	26.55	229.05
	5.00	ATF DEXTRON	TRANSMISSION FLUID	26.55	
	JDP	TRANSMISSION MOUNTS, REPLACED REAR TAIL SHAFT SUPPORTING MOUNT BUSHINGS.	229.50	80.00	309.50
	1.00	UR 2724 TRANSMISSION	REAR MOUNT, SMALL	50.00	
	1.00	UR 2723 TRANSMISSION	REAR MOUNT, LARGE L	30.00	
CFT0	JDP	NEED NEW UPPER CONTROL ARM BUMP STOP, RIGHT SIDE.	27.00	126.67	153.67
	1.00	PD112688PAR	BUMP STOP, SHOCK ARM	126.67	
	JDP	FRONT STABILISER LINK BUSHINGS, RENEW	94.50		94.50
DT 0	JDP	R&R DRIVE SHAFT TO RENEW BOOT IN FRONT OF	540.00	95.55	635.55

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Estimate #0002271

Date : 4/24/17

Page : Page 2 of 3

Center :

Customer : SHREVEPORT LIMOUSINE Address : 1200 MARSHALL STREET City : SHREVEPORT, LA 71101- Phone 1 : (318) 426-0223 Ext : CELL Phone 2 : (318) 603-5315 Ext :	Vehicle : 1957 BENT S1 License : Key# : VIN : B288EG Fleet #: Engine : 298 CID 6/CYL Trans : 4 SPEED HY Mileage : CODE :
---	--

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
		SHAFT			
1.00	UG 3162	SEAL, BOOT DRIVE SHAFT		95.55	
CS10	JDP	COOLANT RUSTY, DRAIN & FLUSH COOLING SYSTEM, FILL WITH NEW ANTIFREEZE	270.00	50.16	320.16
12.00	ANTIFREEZE	EXTENDED LIFE 50/50		50.16	
WP 002	JDP	RENEWED WIPER BLADE ASSEMBLIES.	27.00	80.00	107.00
2.00	UD 2134R 10 INCH	WIPER BLADE ASSY.		80.00	
PAS004	JDP	RPLACED STEERING RAM WITH REBUILT ASSY.	405.00	604.89	1009.89
1.00	UR3252SX	STEERING RAM		583.33	
1.00	JB PSS/551P	POWER STEERING FLUID QT.		21.56	
HSC0	JDP	CHECKED HEATING SYSTEM, LOWER HEATER BLOWER MOTOR GETTING POWER, NOT WORKING. TESTED UPPER HEATER BLOWER MOTOR WIRES BROKEN OFF BUT WILL WORK IF WIRE ARE CONNECTED. NECESSARY TO RECONNECT DISCONNECTED WIRES.	135.00	475.00	610.00
1.00	GOOD USED	BLOWER MOTOR S/C		475.00	
LEX0	JDP	FRONT TURN SIGNALS AND FOG LIGHTS ARE NOT WORKING, WILL BE NECESSARY TO REWIRE DISCONNECTED WIRES AND RECHECK TURN SIGNAL AND FOG LIGHTS.	270.00		270.00
DL 0	JDP	KEY NOT WORKING DOOR LOCKS, REMOVE CLOVE BOX LOCK ASSEMBLY AND HAVE KEY MADE.	67.50	4.92	72.42
1.00	62HE	KEY BLANK , MASTER		4.92	
SU 007	JDP	FREIGHT, UPS PARTS DELIVERY AND INSURANCE.	67.14		67.14
SU 025	JDP	LOCK SMITH, MAKE KEY TO MATCH CLOVE BOX LOCK.	75.00		75.00

PALMA AUTO REPAIR LLC
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
PHONE (856) 547-6522 FAX (856) 546-6137

Estimate #0002271
 Date : 4/24/17
 Page : Page 3 of 3
 Center :

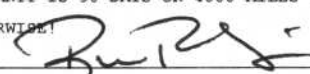
Customer : SHREVEPORT LIMOUSINE Address : 1200 MARSHALL STREET City : SHREVEPORT, LA 71101- Phone 1 : (318) 426-0223 Ext : CELL Phone 2 : (318) 603-5315 Ext :	Vehicle : 1957 BENT S1 License : VIN : B288EG Fleet #: Engine : 298 CID 6/CYL Mileage :	Key# : Trans : 4 SPEED HY CODE :
--	--	--

Op	Tech	Description				Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement			Price		

OK	Bad	Recommendation	OK	Bad	Recommendation	OK	Bad	Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X 

Labor :	\$5,818.50
Parts :	\$4,525.09
Sublet :	\$142.14
Other Fees :	\$0.00
Subtotal :	\$10,495.73
Sales Tax :	\$686.99
Total :	\$11,182.72
Estimate Only	

HEBERT AUTOMOTIVE
 1920 SHREWSBURY ROAD
 METAIRIE, LA 70001
 PHONE: 504-833-3301
 FAX: 504-833-0876

**SPECIALIZING IN BENTLEY
 & ROLLS ROYCE**

Invoice

Bill To: Customer	Date	INVOICE NU...
SHREVEPORT LIMOUSINE RONNIE REMEDIES 318-426-0223	1/8/2018	1750

YEAR/MAKE/MODEL	VIN	MILEAGE	LICENSE NO	PHONE
1957 ROLLS-ROYCE	B288EG	36714		

Item	Qt	Description	Rate	Amount
MIS		TOTAL INVOICE \$ 11734.71	0.00	0.00T
MIS		DEPOSIT \$ 8000.00	0.00	0.00T
MIS		BALANCE \$ 3734.71	0.00	0.00T

SPECIALIZING IN BENTLEY/ROLLS ROYCE	Subtotal	\$10,692.22
Thank you for your business.	Sales Tax (9.75%)	\$1,042.49
I hereby authorize the above work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, and delivery at my risk. It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for repair or while road testing. Authorization: _____	Total	\$11,734.71
	Payments/Credits	\$0.00
	Balance Due	\$11,734.71

HEBERT AUTOMOTIVE
 1920 SHREWSBURY ROAD
 METAIRIE, LA 70001
 PHONE: 504-833-3301
 FAX: 504-833-0876

**SPECIALIZING IN BENTLEY
 & ROLLS ROYCE**

Invoice

Bill To: Customer	Date	INVOICE NU...
SHREVEPORT LIMOUSINE RONNIE REMEDIES 318-426-0223	1/8/2018	1750

YEAR/MAKE/MODEL	VIN	MILEAGE	LICENSE NO	PHONE
1957 ROLLS-ROYCE	B288EG	36714		

Item	Qt	Description	Rate	Amount
LABOR	45	TAKE FRONT END APART TO REPLACE SOME WORN PARTS AND FREE UP RUSTED PARTS	105.00	4,725.00T
PARTS	1	KING PIN KIT	498.75	498.75T
PARTS	1	KING PIN WASHER	4.21	4.21T
PARTS	1	KING PIN WASHER	12.65	12.65T
PARTS	1	OIL RESTRICTOR PIN	10.089	10.09T
PARTS	1	KING PIN THRUST WASHER	33.00	33.00T
PARTS	1	FULCRUM PIN	288.75	288.75T
PARTS	1	UPPER FULCRUM BUSHING	148.50	148.50T
PARTS	1	LOWER FULCRUM PIN	367.50	367.50T
PARTS	2	LOWER OUTER FULCRUM ARMS	295.00	590.00T
MIS		MACHINE SHOP PRESSING BUSHING OUT AND IN	175.00	175.00T
PARTS	2	FRONT SPRINGS	299.25	598.50T
PARTS	2	SPRING SEATS	40.95	81.90T
PARTS	1	INNER FULCRUM BRACKET	1,689.00	1,689.00T
SPECIAL/ORDER		SPECIAL ORDER PARTS	51.25	51.25T
PARTS	2	FULCRUM SEAL	17.65	35.30T
PARTS	1	INNER FULCRUM BLOCK	399.50	399.50T
SPECIAL/ORDER		SPECIAL ORDER PARTS	98.00	98.00T
PARTS	2	IDLER ARM BUSHING	6.36	12.72T
PARTS	1	IDLER DISTANCE TUBE	33.00	33.00T
PARTS	2	O-RINGS	9.65	19.30T
PARTS	2	TIMKEN BEARING	65.49	130.98T
PARTS	2	TIMKEN RACE	42.65	85.30T
UPS/GROUND		UPS GROUND PARTS	58.52	58.52T
LABOR	4	REPLACE ENGINE VALVE COVER AND TWO SIDE COVER GASKET	105.00	420.00T
PARTS	2	SIDE ENGINE GASKET	17.50	35.00T
PARTS	1	VALVE COVER GASKET	41.00	41.00T
PARTS	3	VALVE COVER GROMMET	16.50	49.50T

SPECIALIZING IN BENTLEY/ROLLS ROYCE	Subtotal
Thank you for your business.	Sales Tax (9.75%)
I hereby authorize the above work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, and delivery at my risk. It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for repair or while road testing. Authorization: _____	Total
	Payments/Credits
	Balance Due

HEBERT AUTOMOTIVE

1920 SHREWSBURY ROAD
 METAIRIE, LA 70001
 PHONE: 504-833-3301
 FAX: 504-833-0876

**SPECIALIZING IN BENTLEY
 & ROLLS ROYCE**

Invoice

Bill To: Customer	Date	INVOICE NU...
SHREVEPORT LIMOUSINE RONNIE REMEDIES 318-426-0223	1/9/2018	1752

YEAR/MAKE/MODEL	VIN	MILEAGE	LICENSE NO	PHONE
1957 ROLLS-ROYCE	B288EG	36714		

Item	Qt	Description	Rate	Amount
		ESTIMATE ONLY, PRICES SUBJECT TO CHANGE		
LABOR	4	ENGINE RUNNING ROUGH, REPLACE DISTRIBUTOR CAP AND ROTOR REPLACE SPARK PLUGS, REPLACE POINTS AND CONDENSER .	105.00	420.00T
PARTS	1	AIR CLEANER BELLOW	108.16	108.16T
PARTS	2	SET OF POINTS	25.00	50.00T
PARTS	1	CONDENSER	19.00	19.00T
PARTS	1	DIST ROTOR	22.00	22.00T
PARTS	6	SPARK PLUGS	3.94	23.64T
PARTS	1	DISTRIBUTOR CAP	198.00	198.00T
PARTS	6	PLUGS WIRES	3.00	18.00T
PARTS	6	SPARK PLUG WIRES BOOT	12.00	72.00T
LABOR	4	REMOVE DISTRIBUTOR TO DISMANTLE GO TO MACHINE SHOP TO HAVE OLD BUSHING PRESS OUT AND NEW BUSHING PRESS IN	105.00	420.00T
PARTS	1	DISTRIBUTOR BUSHING	75.00	75.00T
LABOR		MACHINE SHOP (ESTIMATE)	325.00	325.00T
LABOR	6	REMOVE CARB DASH POTS TO CLEAN , REPLACE LOWER RUBBER DIAGRAMS, REPLACE NEEDLE AND SEATS	105.00	630.00T
PARTS	2	NEEDLE AND SEATS KIT	56.00	112.00T
PARTS	2	RED WASHER	2.20	4.40T
PARTS	2	RUBBER DIAGRAM	85.00	170.00T
LABOR	1	REPLACE OIL AND FILTER	105.00	105.00T
20/50	9	CASTROL 20/50	6.99	62.91T
OILFILTERKIT		OIL FILTER KIT	52.84	52.84T
LABOR	1	REPLACE A/C BELT	105.00	105.00T
PARTS	1	A/C BELT	19.50	19.50T
LABOR	2	REMOVE REAR FUEL TO REPLACE GASKET AND CLEAN SCREEN	105.00	210.00T
PARTS	1	FUEL GASKET KIT	21.00	21.00T
UPS/GROUND		UPS GROUND PARTS	60.00	60.00T

SPECIALIZING IN BENTLEY/ROLLS ROYCE	Subtotal
Thank you for your business.	Sales Tax (9.75%)
I hereby authorize the above work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, and delivery at my risk. It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for repair or while road testing. Authorization: _____	Total
	Payments/Credits
	Balance Due

HEBERT AUTOMOTIVE
 1920 SHREWSBURY ROAD
 METAIRIE, LA 70001
 PHONE: 504-833-3301
 FAX: 504-833-0876

**SPECIALIZING IN BENTLEY
 & ROLLS ROYCE**

Invoice

Bill To: Customer	Date	INVOICE NU...
SHREVEPORT LIMOUSINE RONNIE REMEDIES 318-426-0223	1/9/2018	1752

YEAR/MAKE/MODEL	VIN	MILEAGE	LICENSE NO	PHONE
1957 ROLLS-ROYCE	B288EG	36714		

Item	Qt	Description	Rate	Amount
MIS		NEED DEPOSIT \$ 1600.00	0.00	0.00

SPECIALIZING IN BENTLEY/ROLLS ROYCE	Subtotal	\$3,303.45
Thank you for your business.	Sales Tax (9.75%)	\$322.09
I hereby authorize the above work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, and delivery at my risk. It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for repair or while road testing. Authorization: _____	Total	\$3,625.54
	Payments/Credits	\$0.00
	Balance Due	\$3,625.54

Bentley-Parts

Supplier of Rolls-Royce & Bentley Motor Car parts since 1979

Invoice



PO Box 152 (Mail Only)
117 W. Wilson Street
Villa Rica, GA 30180

Tel# 770-459-0040
Fax # 770-459-8935

info@replacementpartsinc.com

Order Page: www.ReplacementPartsInc.com

Date	Invoice #
9/13/2017	039877

Bill To

Ship To

Shreveport Limousine
Ronnie Remedies
1200 Marshall
Shreveport, LA 71101

Bentley

S.h. Card

P.O. No.	Terms	Rep	Ship Date	Ship Via	FOB
	Credit Card	JA	9/13/2017	Fed Ex Ground	Villa Rica
Qty	Item	Description	Price Each	B/O	Amount
1	C-12K	Door Weatherstrip Kit, Standard Cloud/S	285.00	0	285.00
1	A-NEO	Neoprene Adhesive, 1 quart	0.00	0	0.00
1	CWC-Flex	Flexible Window Channel Set	180.00	0	180.00
1	SWS-124	Side Window Sweeps, (4)	64.00	0	64.00
1	FELT-12	Glass/Wood Felt Strips, 1/2"	28.50	0	28.50
1	C-21	EZ Door Sill To Window Frame Strip Kit, STD, (4)	62.00	0	62.00
1	C-70	Windshield Seal, Cloud/S	190.00	0	190.00
1	C-2103	Trunk Handle Seals,(3), Cloud/S-1	12.50	0	12.50
1	C-172A	Hood Lacing Set, Cloud/S	32.50	0	32.50
1	CVW-10	Vent Window Seal, Left Side, Cloud/S	183.65	0	183.65
1	CVW-11	Vent Window Seal, Right Side, Cloud/S	183.65	0	183.65
1	C-81	License Frame Edge Channel, RHD	18.50	0	18.50
	Shipping	Shipping & Insurance	17.09		17.09
		FedEx Package 1 Tracking #: 787715931500 Shipping Charges: \$17.09			
		<i>\$ 65.00</i>			

Returned orders within the USA are subject to a 20% restocking charge. Returns must be done within 30 days of original purchase date. All special ordered items are non-returnable indicated with SO. All rebuildable cores must be returned within 30 days of receipt. Cores must be in rebuildable condition for refund. This return policy does not apply to engine or transmission. Failure to notify Replacement Parts of damaged goods when received will void a replacement order.

SO= Special Ordered Items
NOS=New Stock
USED=Used Item
O/H=Rebuilt Item

Subtotal	\$1,257.39
Sales Tax (0.0%)	\$0.00
Total	\$1,257.39
Payments/Credits	-\$1,257.39
Balance Due	\$0.00