

# British Automotive Repair, LLC

14850 N 83rd Place, Suite A-1  
Scottsdale, AZ 85260  
Phone: 480-596-5247 Fax: 480-596-5240

02/22/2023 2:36:44 PM

Invoice #  
**10458**

**Tom Fusco**  
37706 N 102nd Pl  
Scottsdale, AZ 85262  
Cellular (480) 271-9935

**1976 Rolls Royce Silver Shadow Brown/Black**  
Odometer In: 96121 Odometer Out: 96124  
License: VWS9 VIN: **SRE26518**



## Invoice

Vehicle Time In: 2/22/2023 2:36:15PM

\*\*\*TOW IN\*\*\*

Please see attached client list

### 02/01/2023

Started vehicle and checked level of brake fluid after running for a couple of minutes per the vehicle manual. Found fluid in the rear reservoir was extremely low. Started to fill reservoir using proper fluid. Found level not increasing. Saw fluid leaking under vehicle and shut off vehicle. Found that hose from rear reservoir not hooked up to anything and just draining all fluid out. Found where hose should connect to. Removed hose and cut new hose to replace broken and cracked hose. Installed new hose with new hose clamps. Cleaned underside of vehicle of all brake fluid.

**Labor:** \$340.00 **Hrs:** 2.00 **Parts:** \$0.00 **Sublet:**\$0.00 **Job Total:** \$340.00

### 02/02/2023

Bled brakes on all 4 wheels to eliminate all air from hydraulic system. All 4 brakes bled at this point and no lights on the dash at this time pertaining to brakes. Found coolant tank low. Filled tank and found all coolant to immediately leak out of tank through water pump weep hole. Recommend replace water pump and all related hoses and seals. Found tires to be 9 years old. Found a couple of bulbs not functioning properly (side marker and tag lamp).

**Labor:** \$680.00 **Hrs:** 4.00 **Parts:** \$0.00 **Sublet:**\$0.00 **Job Total:** \$680.00

### 02/14/2023

Drained coolant from radiator by attaching hose to drain valve then opening drain valve and allowing all coolant to drain into coolant receptacle. Closed coolant drain valve. Removed upper radiator hose and then all hoses attached to header tank. Removed header tank by removing three bolts and then the header tank. Removed upper part of fan shroud by removing two nuts on either side of fan shroud. Removed 4 nuts holding on fan and viscous coupling from water pump pulley. Removed fan assembly from vehicle. Loosened all accessories holding tension on belts and relieved tension from all belts. Removed all belts from vehicle. Removed water pump pulley from water pump. Removed 6 bolts holding water pump to housing. Removed grill from vehicle and then removed power steering cooler. Cleaned cooler and installed new hoses. Reinstalled cooler. Reinstalled grill. Removed and replaced all soft hoses to heater core. Cleaned water pump housing mating surface.

**Labor:** \$1,020.00 **Hrs:** 6.00 **Parts:** \$0.00 **Sublet:**\$0.00 **Job Total:** \$1,020.00

### 02/15/2023

Installed water pump onto vehicle. Removed old power steering supply hose by removing connections at steering box and connection at pump. Removed clamps holding hose to engine crossmember and removed hose from vehicle. Found new hose to need adapter installed into power steering pump. Removed pump from vehicle and removed adapter for hose. Installed provided adapter and reinstalled pump into vehicle. Installed hose into vehicle and installed clamps onto hose and onto engine crossmember. Removed soft hose sections for power steering return line. Installed new hose sections to replace old sections. Removed lower radiator hose by removing two clamps and removing from vehicle. Installed new lower radiator hose and reinstalled two clamps. Cleaned engine cooling fan of loose paint and dirt.


**Labor:** \$935.00 **Hrs:** 5.50 **Parts:** \$0.00 **Sublet:**\$0.00 **Job Total:** \$935.00

### 02/16/2023

Installed all accessory belts and adjusted to proper tightness. Tightened all accessory drive bolts. Installed fan onto water pump using new nuts and washers provided. Installed fan shroud pieces onto radiator. Installed header tank onto radiator and connected all hoses. Filled cooling system and checked for leaks when not running. Found no leaks at this time. Filled power steering pump reservoir and no leaks found at this time.

**Labor:** \$425.00 **Hrs:** 2.50 **Parts:** \$0.00 **Sublet:**\$0.00 **Job Total:** \$425.00



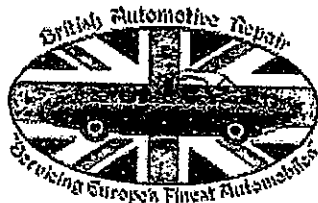

# British Automotive Repair, LLC

14850 N 83rd Place, Suite A-1  
Scottsdale, AZ 85260

Phone: 480-596-5247 Fax: 480-596-5240

02/22/2023 2:36:44 PM

Invoice #  
**10458**

## Tom Fusco

37706 N 102nd Pl  
Scottsdale, AZ 85262  
Cellular (480) 271-9935

## 1976 Rolls Royce Silver Shadow Brown/Black

Odometer In: 96121 Odometer Out: 96124  
License: VVS9 VIN: SRE26518

## Invoice

*Continued From Previous Page*

**02/17/2023**

Started vehicle and checked for coolant or power steering leaks. Found no leaks from those systems at this time. Found drivers rear brake bleeder leaking. Removed bleeder and found that metal sealing ball had been put into vehicle. Found bleeder had been over tightened at some point and messed up sealing surface of bleeder. Installed new bleeder with sealing ball and no leaks after bleeder installed.

**Labor:** \$340.00 **Hrs:** 2.00 **Parts:** \$0.00 **Sublet:** \$0.00 **Job Total:** \$340.00

**02/20/2023**

Removed power steering cooler from vehicle by removing hoses from cooler and then removing two bolts from core support. Installed new cooler by installing hoses onto cooler and then installing two bolts into core support. Reinstalled grill into vehicle with 4 bolts into core support and two into lower core support

**Labor:** \$170.00 **Hrs:** 1.00 **Parts:** \$0.00 **Sublet:** \$0.00 **Job Total:** \$170.00

**02/22/23**

Lifted vehicle, removed drain plug. Allowed crankcase to relieve of oil. While oil sump draining, removed filter housing and drained of oil. Washed out oil filter housing in solvent, wiped dry. Replaced sealing ring in filter housing manifold, loaded filter housing with new filter and sealing washers. Re-fit filter housing, installed retaining bolt and torqued. Greased zerk fittings with approved grease lubricant. Re-fit drain plug with new sealing washer, torqued. Lowered vehicle, filled crankcase to capacity per manufacturer specifications. Started vehicle momentarily until oil pressure stabilized, shut down engine. Checked oil level, test drive vehicle. Upon return, checked fluid levels and tire pressure, topped off as needed.

Part Number	Description	Quantity	Sale	Extended
UE37287R	Water Pump	1.00	\$395.00	\$395.00
UE9671R	O-Ring	1.00	\$8.44	\$8.44
SPC2680	Alt. Belt	1.00	\$34.99	\$34.99
SPC1554	Air Pump Belt	1.00	\$23.74	\$23.74
UR17808R	Upper Radiator Hose	1.00	\$100.00	\$100.00
UR17807R	Lower Radiator Hose	1.00	\$106.93	\$106.93
UR18549R	Bleed Hose	1.00	\$43.75	\$43.75
UE34280	Pas Cooler	1.00	\$193.75	\$193.75
UR17761R	Bypass Hose	1.00	\$75.00	\$75.00
UE38223R	Heater Hose	1.00	\$74.99	\$74.99
UR17763R	Heater Hose	1.00	\$123.75	\$123.75
RH10003	Oil Filter	1.00	\$60.29	\$60.29
RH2818R	Pas HP Hose	1.00	\$207.38	\$207.38
RR363	H/D BRAKE FLUID	1.00	\$51.88	\$51.88
UR27332R	Pas Return Hose	1.00	\$49.99	\$49.99
121006	Pas Hose	1.00	\$16.63	\$16.63
257640	Belt	2.00	\$34.90	\$69.80
257350	Belt	2.00	\$27.78	\$55.56
20W50	GTX 20w50 Castrol Oil	10.00	\$6.50	\$65.00
ATF	ATF	1.00	\$24.00	\$24.00
<b>Labor:</b> \$170.00 <b>Hrs:</b> 1.00 <b>Parts:</b> \$1,780.87 <b>Sublet:</b> \$0.00				<b>Job Total:</b> \$1,950.87





# British Automotive Repair, LLC

14850 N 83rd Place, Suite A-1  
Scottsdale, AZ 85260  
Phone: 480-596-5247 Fax: 480-596-5240

04/06/2018 1:48:54 PM

Invoice #  
**1154**

## Tom Fusco

37706 N 102nd Pl  
Scottsdale, AZ 85262  
Cellular 908-242-7599

## 1976 Rolls Royce Silver Shadow Brown/Black

Odometer In: 94925 Odometer Out: 94929  
License: VVS9 VIN: SRE26518

## INVOICE

Vehicle Time In: 4/6/2018 1:47:25PM

Client states low brake fluid light on

Client states gas tank button not functioning

Client request lube, oil and filter service.

Client states rear windows go down but need help moving up

Client states radio is not working

Client request A/C recharge

4/6/2018

Perform oil and filter change. Inspect vehicle for hydraulic leaks, several small seeps noted, however the main leak is from the right rear height control ram. The leak is not severe at this time but will need to be addressed in the future. The client has been advised of this. Hydraulic fluid was topped off. Trunk pop and radio both found to be inop, trace wiring and check for power at both. Problem found to be a blown rebuildable fuse that controls the circuit both items are on. Repair fuse and reinstall. Both units now function correctly.

Part Number	Description
20W50	Oil
Fluid	Brake Fluid
RH1003	Oil Filter

Quantity	Sale	Extended
10.00	\$4.75	\$47.50
1.00	\$13.95	\$13.95
1.00	\$53.00	\$53.00

Labor: \$325.00 Hrs: 2.50 Parts: \$114.45 Sublet: \$0.00

Job Total: \$439.45

12/29/21 - OIL CHANGED

ODOMETER 95,321


Service Advisor: Enriquez, Robyn  
Technician(s): Wormsbacher, Zach

I consent to receiving text messages regarding your services, via automated technology, to the cell phone number you have on file. I acknowledge that I do not have to provide this consent to receive your services. Message and data rates may apply. Respond STOP to any message to cancel.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Labor Total:	\$325.00
Parts Total:	\$114.45
Sublet Total:	\$0.00
Shop Supplies:	\$6.59
HazMat:	\$0.00

Sub Total:	\$446.04
Tax Total:	\$9.10
Grand Total:	\$455.14
Balance Due:	\$455.14

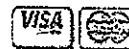

SIGNATURE.....

DATE.....

