



1967 MG MGB

## VEHICLE INFORMATION

**VIN:** GHN3L  
**Engine Size/Type:** 1800  
**Transmission Type:** Manual  
**Drive Type:** RWD  
**Mileage:** 40664

## EVALUATION INFORMATION

**Evaluation Result:** INSPECTED  
**Date:** 07/29/2020  
**Technician ID:** Drake Kaminski  
**RRC ID:** TES4Y

Evaluation criteria reviewed and approved by the  
McPherson College Auto Restoration Program.



## About Pre-Purchase Inspections

This report has been compiled based on the results of the Road Ready inspection performed by a qualified, specially trained inspector. The report demonstrates the condition of the vehicle based on a comprehensive visual inspection and road test of the vehicle **at the time of the inspection**.

The inspection report documents specific inspection points, a test drive & performance qualities, and dozens of condition photos of the exterior, interior, underhood, drivetrain, chassis and undercarriage of the vehicle.

### **Please Note:**

Under most circumstances, the inspector will drive the vehicle in order to best determine the vehicle's handling and overall roadworthiness. However, in certain instances, the vehicle owner is reluctant to have persons other than themselves drive their vehicle, even though our inspectors are highly qualified to do so. **In those cases the seller is requested to drive the vehicle following instructions provided by the inspector and the inspector will ride along and observe the vehicle characteristics during that test drive.**

**Also, our inspectors do not use tools and are not permitted to unseal, disassemble, or otherwise handle any hidden vehicle components. They can only document what they can observe in ambient light or with a flashlight.**

Also, sellers will not generally allow any disassembly of the vehicle for testing or diagnosis. Therefore, our inspectors do not perform any disassembly of the vehicle for their testing purposes. In addition, because our inspections are mobile, there rarely are lifts available that would allow us unimpeded physical access underneath the vehicle. The Road Ready inspection was specifically designed to extract specific information from various systems and components through visual inspection techniques, vehicle performance characteristics and specific road testing observations.

### **Reminder:**

Most classic vehicles are generally going to have, at a minimum, some type of minor defects. Some defects, and the degree of defect, are more subjective than objective. Subjectivity can sometimes result in slightly different opinions and observations. Road Ready Inspections recommends close comparison and examination of both the seller's photos and description, and the inspection photos provided to help you make an informed buying decision.

**The inspector cannot provide you with advice on whether to purchase or not purchase this vehicle.**

**Road Ready Inspections makes no representations or warranties regarding its service in consideration of vehicle design, compliance with manufacturer specifications, operation, mechanical condition, safety, authenticity, provenance, title history, registration history, or market value of any vehicle inspected, or of any component parts.**

## How To Use This Report

### FOR BUYERS:

In order to maximize the information and value this report provides, Road Ready Inspections recommends using this report to:

1. Determine the accuracy of the owner's description and confirm their statements of condition.
2. Follow up with the vehicle owner regarding any new concerns raised from the inspection (request additional clarification, photos or video).
3. Provide support during negotiations with the vehicle owner or for estimating vehicle repair costs.
4. Get a better idea of valuation when combined with further research to make a more informed decision.
5. Compare the condition of this vehicle to the condition of others like it that you are considering.

### FOR SELLERS:

In order to maximize the information and value this report provides, Road Ready Inspections recommends using this report to:

1. Provide prospective buyers with the report when they come to see your vehicle. A comprehensive, unbiased inspection report verified by a third party builds buyer confidence
2. Email the report and 30+ color photos to prospective buyers who are interested in buying the vehicle sight unseen.
3. When listing the vehicle for sale provide a link to an electronic version of your report, or state that the car has been inspected by Road Ready Inspections.
4. Use the report as a tool to illustrate the condition of the vehicle. Remember buyers of classic cars are not expecting the car to be perfect, they just want to know the true condition of the vehicle so they can make a confident buying decision.
5. Use the report to provide support during negotiations with the buyer, making for a smoother, faster sale.

## Partner Promotions



# Exterior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

| Exterior - Body   |                               |   |   |    |
|---|-------------------------------|---|---|----|
| ID#   | Test Point                    | S | R | NA |
| 1   | General Body Condition        | ✓ |   |    |
| This is a complete restoration and it is in amazing condition |                               |   |   |    |
| 2   | Body Modifications            | ✓ |   |    |
| 3   | Body Panel Fit                | ✓ |   |    |
| great panel fit   |                               |   |   |    |
| 4   | Paint Condition               | ✓ |   |    |
| Nice quality paint job  |                               |   |   |    |
| 5   | Rust / Corrosion              | ✓ |   |    |
| No rust   |                               |   |   |    |
| 6   | Door Condition                | ✓ |   |    |
| 7   | Door Weatherstripping         | ✓ |   |    |
| 8   | Door Handles / Locks          | ✓ |   |    |
| 9   | Front Fenders                 | ✓ |   |    |
| 10  | Rear Fenders                  | ✓ |   |    |
| 11  | Hood Condition                | ✓ |   |    |
| 12  | Roof / Pillars / Roof Rack    | ✓ |   |    |
| 13  | Trunk / Hatchback             | ✓ |   |    |
| 14  | Front Bumper                  | ✓ |   |    |
| 15  | Rear Bumper                   | ✓ |   |    |
| 16  | Fuel Door Operation / Gas Cap | ✓ |   |    |
| 17  | Side Mirrors                  |   |   | ✓  |
| No mirrors by design  |                               |   |   |    |
| 18  | Truck Bed / Tailgate          |   |   | ✓  |

# Exterior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

### Exterior - Glass / Trim

| ID#                          | Test Point                | S | R | NA |
|------------------------------|---------------------------|---|---|----|
| 19                           | Front Windshield          | ✓ |   |    |
| 20                           | Rear Windshield Condition | ✓ |   |    |
| clear                        |                           |   |   |    |
| 21                           | Door Glass Condition      | ✓ |   |    |
| 22                           | Grill                     | ✓ |   |    |
| 23                           | Body Trim / Moldings      | ✓ |   |    |
| 24                           | Chrome Condition          | ✓ |   |    |
| Excellent condition          |                           |   |   |    |
| 25                           | Convertible Top           | ✓ |   |    |
| Top is new and it works well |                           |   |   |    |
| 26                           | Wipers Front / Rear       | ✓ |   |    |
| 27                           | Antenna / Operation       | ✓ |   |    |

### Exterior - Lighting

|                     |                              |   |  |   |
|---------------------|------------------------------|---|--|---|
| 28                  | Headlights & High / Low      | ✓ |  |   |
| 29                  | Fog Lights                   | ✓ |  |   |
| Nice big fog lights |                              |   |  |   |
| 30                  | Side Marker Lights           | ✓ |  |   |
| 31                  | Tail Lights                  | ✓ |  |   |
| 32                  | Turn Signals                 | ✓ |  |   |
| 33                  | Brake Lights / Center Light  | ✓ |  |   |
| 34                  | Emergency Road Hazard Lights | ✓ |  |   |
| 35                  | Reverse Lights               | ✓ |  |   |
| 36                  | License Lights               | ✓ |  |   |
| 37                  | Other Lights                 |   |  | ✓ |

# Interior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

Interior - Condition

| ID#   | Test Point                         | S | R | NA |
|---|------------------------------------|---|---|----|
| 38  | General Condition / Odors / Mildew | ✓ |   |    |
| Interior appearance is perfect and the seats have that firm but subtle feel |                                    |   |   |    |
| 39  | Interior Modifications             | ✓ |   |    |
| no visors by design   |                                    |   |   |    |
| 40  | Headliner                          |   |   | ✓  |
| 41  | Front Seat Cover(s)                | ✓ |   |    |
| 42  | Rear Seat Cover(s)                 |   |   | ✓  |
| 43  | Seat Belts                         | ✓ |   |    |
| 44  | Headrests                          |   |   | ✓  |
| 45  | Front Carpet / Floor Mats          | ✓ |   |    |
| 46  | Rear Carpet / Floor Mats           | ✓ |   |    |
| 47  | Cargo Carpet                       | ✓ |   |    |
| 48  | Door Sill Plates                   | ✓ |   |    |
| 49  | Door Trim Panels                   | ✓ |   |    |
| 50  | Door Glasses / Tint                | ✓ |   |    |
| 51  | Dashboard                          | ✓ |   |    |
| Nice wrinkle paint finish is flawless                                       |                                    |   |   |    |
| 52  | Interior Trim / Moldings           | ✓ |   |    |
| 53  | Airbag Covers                      |   |   | ✓  |
| 54  | Glove Box Operation                | ✓ |   |    |
| 55  | Spare Tire                         | ✓ |   |    |
| 56  | Tire / Jack / Tools                | ✓ |   |    |
| 57  | Toolkit Complete                   |   |   | ✓  |

# Interior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

### Interior - Convenience & Controls

| ID#                               | Test Point                  | S | R | NA |
|-----------------------------------|-----------------------------|---|---|----|
| 58                                | General Condition           | ✓ |   |    |
| Excellent condition top to bottom |                             |   |   |    |
| 59                                | Owners Manuals              |   |   | ✓  |
| 60                                | Gearshift Operation         | ✓ |   |    |
| 61                                | Parking Brake Control       | ✓ |   |    |
| 62                                | Hood Release                | ✓ |   |    |
| 63                                | Tilt Steering               |   |   | ✓  |
| 64                                | Seat Position Adjusters     | ✓ |   |    |
| 65                                | Power Seat Switch / Motor   |   |   | ✓  |
| 66                                | Power Window Switch / Motor |   |   | ✓  |
| 67                                | Door Locks / Power Switches | ✓ |   |    |
| 68                                | Power Mirrors               |   |   | ✓  |
| 69                                | Sunroof                     |   |   | ✓  |
| 70                                | Sunvisor Vanity Mirrors     |   |   | ✓  |
| 71                                | Windshield Wiper Controls   | ✓ |   |    |
| 72                                | Defogger / Defogger Light   | ✓ |   |    |
| 73                                | Horn                        | ✓ |   |    |
| 74                                | Remote Fuel Door Release    |   |   | ✓  |
| 75                                | Remote Trunk Release        |   |   | ✓  |
| 76                                | Cigarette Lighter           | ✓ |   |    |
| 77                                | Remote Key FOB              |   |   | ✓  |
| 78                                | Alarm                       |   |   | ✓  |

# Interior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

### Interior - Instruments/Lighting

| ID#                                 | Test Point                  | S | R | NA |
|-------------------------------------|-----------------------------|---|---|----|
| 79                                  | Gauges                      | ✓ |   |    |
| All gauges and switches are working |                             |   |   |    |
| 80                                  | Odometer                    | ✓ |   |    |
| 81                                  | Dash/Instrument Lighting    | ✓ |   |    |
| 82                                  | Check Engine Light          |   |   | ✓  |
| 83                                  | Airbag Warning Light        |   |   | ✓  |
| 84                                  | ABS Warning Light Operation |   |   | ✓  |
| 85                                  | Clock                       |   |   | ✓  |
| 86                                  | Dome Light                  | ✓ |   |    |
| 87                                  | Rear View Mirror / Compass  | ✓ |   |    |
| 88                                  | Sunvisor Vanity Lights      |   |   | ✓  |
| 89                                  | Trunk Light                 |   |   | ✓  |
| 90                                  | Warning Lights - Other      | ✓ |   |    |



# Interior Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

### Interior - Heating and A/C

| ID# | Test Point                     | S | R | NA |
|-----|--------------------------------|---|---|----|
| 91  | A/C Operation / Temperature    |   |   | ✓  |
| 92  | Heater Operation / Temperature | ✓ |   |    |
| 93  | Climate Control Operation      | ✓ |   |    |
| 94  | Blower Speeds / Operation      | ✓ |   |    |
| 95  | A/C Registers                  |   |   | ✓  |
| 96  | Seat Heater / Cooler Operation |   |   | ✓  |

### Interior - Radio Entertainment

|                              |                               |   |  |   |
|------------------------------|-------------------------------|---|--|---|
| 97                           | Radio Operation / Condition   |   |  | ✓ |
| Radio delete plate installed |                               |   |  |   |
| 98                           | Speaker Operation / Condition | ✓ |  |   |
| Has a new speaker and box    |                               |   |  |   |
| 99                           | CD/DVD Operation              |   |  | ✓ |
| 100                          | Navigation System             |   |  | ✓ |
| 101                          | Back Up Camera                |   |  | ✓ |
| 102                          | Rear Entertainment System     |   |  | ✓ |

# Engine & Under-Hood Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

## Engine & Under-Hood

| ID#  | Test Point                            | S | R | NA |
|--|---------------------------------------|---|---|----|
| 103  | Engine / Underhood Modifications      | ✓ |   |    |
| Engine bay is nicely restored and period correct |                                       |   |   |    |
| 104  | Hood Release Operation                | ✓ |   |    |
| 105  | Hood Latch Operation                  | ✓ |   |    |
| 106  | Hood Hinges / Struts                  | ✓ |   |    |
| 107  | Hood Insulation                       | ✓ |   |    |
| 108  | Engine Emissions Placard              | ✓ |   |    |
| 109  | Engine Emissions System               | ✓ |   |    |
| 110  | Battery Condition / Battery Hold Down | ✓ |   |    |
| 111  | Alternator / Generator                | ✓ |   |    |
| 112  | Engine Wiring                         | ✓ |   |    |
| 113  | Engine Leaks                          | ✓ |   |    |
| 114  | Cooling System / Radiator / Cap       | ✓ |   |    |
| 115  | Radiator Coolant Condition            | ✓ |   |    |
| clean and full                                   |                                       |   |   |    |
| 116  | Heater Hoses - A/C Hoses              | ✓ |   |    |
| 117  | Drive Belts Condition                 | ✓ |   |    |
| 118  | Air Cleaner / Filter                  | ✓ |   |    |
| 119  | Engine Oil Condition                  | ✓ |   |    |
| clean  |                                       |   |   |    |
| 120  | Engine Oil Sludge                     | ✓ |   |    |
| 121  | Transmission Fluid Condition          |   |   | ✓  |
| under vehicle and not checked                    |                                       |   |   |    |
| 122  | Power Steering System                 |   |   | ✓  |
| 123  | Brake Master Cylinder Fluid Check     | ✓ |   |    |
| 124  | Windshield Washer Fluid               | ✓ |   |    |

# Drivetrain & Chassis Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

## Drivetrain & Chassis


| ID#   | Test Point                            | S | R | NA |
|---|---------------------------------------|---|---|----|
| 125   | Chassis / Undercarriage Condition     | ✓ |   |    |
| Vehicle inspected at ground level. Undercarriage is very nice and also restored |                                       |   |   |    |
| 126   | Chassis / Undercarriage Modifications | ✓ |   |    |
| 127   | Frame / Unibody Condition             | ✓ |   |    |
| 128   | Exhaust System                        | ✓ |   |    |
| 129   | Suspension Systems                    | ✓ |   |    |
| 130   | Shock Absorbers                       | ✓ |   |    |
| 131   | Steering Condition                    | ✓ |   |    |
| 132   | Transmission / Cooler Line Leaks      | ✓ |   |    |
| 133   | Brakes                                | ✓ |   |    |
| 134   | Tire Condition and Tread Depth        | ✓ |   |    |
| New   |                                       |   |   |    |
| 135   | Wheel Condition                       | ✓ |   |    |
| Perfect   |                                       |   |   |    |
| 136   | Tire Data Map                         | ✓ |   |    |

### Right Front Tire

Manufacturer: Yokohama  
Size: 195 65 15  
Tread Depth: 9 32/32"

### Right Rear Tire

Manufacturer: Yokohama  
Size: 195 65 15  
Tread Depth: 9 32/32"

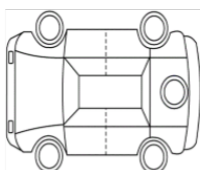

### Left Front Tire

Manufacturer: Yokohama  
Size: 195 65 15  
Tread Depth: 9 32/32"

### Left Rear Tire

Manufacturer: Yokohama  
Size: 195 65 15  
Tread Depth: 9 32/32"

### Spare Tire

Manufacturer: Yokohama  
Size: 195 65 15  
Tread Depth: 9 32/32"

# Test Drive Inspection

The following points represent a visual check of a vehicle's condition, body, glass and trim. For more detailed information regarding the individual items inspected in this section please refer to the "Road Ready Inspection Details" section located at the back of this report.

## Legend:

**(S)** Satisfactory—Normal condition and wear for year/mileage, proper functionality, repairs not needed

**(R)** Repair—In need of repair, replacement or maintenance

**(N/A)** Not Applicable

For photos of items marked as damaged or requiring repair, please refer to the "Photos—Damage/Repairs Needed" section of this report located at the end of the Vehicle Photos.

### Test Drive

| ID#  | Test Point                                  | S | R | NA |
|--|---|---|---|----|
| 137  | Test Drive Length and Speed                 | ✓ |   |    |
| 4 miles up to 65 mph and this vehicle is a pleasure to drive and it is tight and responsive with great pep |   |   |   |    |
| 138  | Cold / Hot Start Quality                    | ✓ |   |    |
| 139  | Starter Function Quality                    | ✓ |   |    |
| 140  | Engine Idle Quality                         | ✓ |   |    |
| 141  | Engine Noise / Knocks / Rattles             | ✓ |   |    |
| quite  |   |   |   |    |
| 142  | Engine Smokes / Excessive Blowby            | ✓ |   |    |
| No smoke   |   |   |   |    |
| 143  | Normal Engine Operating Temperature         | ✓ |   |    |
| 144  | Engine Acceleration / Power Check           | ✓ |   |    |
| 145  | Exhaust Noise Level                         | ✓ |   |    |
| 146  | Transmission / Clutch Operation             | ✓ |   |    |
| 147  | Transmission Shift / Gears Operate Smoothly | ✓ |   |    |
| Smooth shifting and clutch engagement is good  |   |   |   |    |
| 148  | Steering Wheel Centered                     | ✓ |   |    |
| 149  | Steering System Operation                   | ✓ |   |    |
| 150  | Vehicle Alignment / Tracking Check          | ✓ |   |    |
| No wander and tracks straight  |   |   |   |    |
| 151  | Abnormal Road Vibration                     | ✓ |   |    |
| 152  | Abnormal Tire Noise                         | ✓ |   |    |
| 153  | Suspension and Handling Quality             | ✓ |   |    |
| 154  | Brake Operation                             | ✓ |   |    |
| 155  | Parking Brake Operation                     | ✓ |   |    |
| 156  | Speedometer / Odometer Operation            | ✓ |   |    |
| 157  | Abnormal Wind Noise                         | ✓ |   |    |
| 158  | Squeaks / Rattles                           | ✓ |   |    |

## Vehicle Photos

The following photographs were taken by the Road Ready Certified Inspections technician at the time of the Road Ready Evaluation. The Vehicle Photos pages may serve as a resource when applying for vehicle insurance requiring the vehicle description and photos.



Vehicle Front



behind seat



dash



engine



## Vehicle Photos



engine



engine bay



engine number



exhaust



floor



fog lights



## Vehicle Photos



front



front



front



front



front



front



## Vehicle Photos



fuel cap



glove box



glovebox



good



good



hinges



## Vehicle Photos



hood



hoses



interior



left



left door



left door



## Vehicle Photos



left door



left rear



mirror



oil full and clean



paint good



rear



## Vehicle Photos



rear



rear carpet



right



right



right door



right door



## Vehicle Photos



right door



right rear



seats



shifter



spare



speedometer



## Vehicle Photos



top



top



top



top



trunk



trunk



## Vehicle Photos



trunk



trunk



trunk lid



under



under



under rear



# Vehicle Photos



under rocker



Vehicle



Vehicle



VIN tag



wheel



wheel



## Vehicle Photos



wheel



wheels



windshield



windshil



# 158-Point Road Ready Inspection Details

| DOCUMENTATION                             |
|---|
| Year/Make/Model                           |
| Dash Vehicle Identification Number        |
| Door Vehicle Identification Number        |
| Engine Type - as currently equipped       |
| Transmission Type - as currently equipped |
| Drive Type - as currently equipped        |
| Mileage - as indicated                    |
| Exterior Color - as current               |
| Interior Color - as current               |

| ID# | EXTERIOR—BODY<br>Test Point  |
|-----|--|
| 1   | General Body Condition - current or visual previous body/paint damage present on body panels or structural components      |
| 2   | Body Modifications - fenders, doors, hood, roof, trunk, lights   |
| 3   | Body Fit - fender, doors, hood, trunk, alignment and body gaps   |
| 4   | Paint Condition - condition and quality, scrapes, scratches, runs  |
| 5   | Rust/Corrosion - existence, severity   |
| 6   | Door Condition - dents, dings, scrapes, scratches, alignment   |
| 7   | Door Weatherstripping - doors and windows for condition, rips, tears   |
| 8   | Door Handles/Condition/Operation - latches, hinges, hinge pins, striker plates, door stops, hardware                       |
| 9   | Front Fenders Condition - dents, dings, scrapes, scratches, alignment  |
| 10  | Rear Fenders Condition - dents, dings, scrapes, scratches, alignment   |
| 11  | Hood Condition -dents, dings, scrapes, scratches, alignment  |
| 12  | Roof/Pillars/Rack Condition - dents, dings, hail damage, scrapes, scratches  |
| 13  | Trunk/Hatchback Condition - Fit/Latch - dents, dings, hail damage, scrapes, scratches, hinges, latches, strikers, hardware |
| 14  | Front Bumpers Condition - dents, dings, scrapes, scratches, rips, tears, mounts, security, alignment                       |
| 15  | Rear Bumpers Condition - dents, dings, scrapes, scratches, rips, tears, mounts, security, alignment                        |
| 16  | Fuel Door Operation/Gas Cap - operation, alignment, security, latch, latch pin operation                                   |
| 17  | Side Mirrors - damage, security, alignment operation   |
| 18  | Truck Bed/Tailgate Condition - dents, dings, scrapes, scratches,   |

| ID# | EXTERIOR—GLASS/TRIM<br>Test Point   |
|-----|---|
| 19  | Front Windshield Condition - cracks, chips, bubbles, clarity, security  |
| 20  | Rear Windshield Condition - cracks, chips, bubbles, clarity, security   |
| 21  | Door Glass Condition - cracks, chips, bubbles, clarity, security  |
| 22  | Grill - presence, condition, dents, dings, scrapes,   |
| 23  | Body Trim/Moldings - presence, condition, dents, dings, scrapes, tears, rips  |
| 24  | Chrome Condition - dents, dings, scrapes, tarnished, pitted   |
| 25  | Convertible Top Condition/Operation - window condition, switches, motors, latches, hinges, boot, proper operation, rips, tears, stitching condition |
| 26  | Wipers Front/Rear - motors, transmissions, arms, blades, hardware, condition, proper operation, security, wear                                      |
| 27  | Antenna/Operation - condition, security, motor operation, antenna function  |

# 158-Point Road Ready Inspection Details

| EXTERIOR—LIGHTING |   |
|-------------------|---|
| ID#               | Test Point  |
| 28                | Headlights - High/Low - lens, housing, bulb, condition, security, operation, clarity  |
| 29                | Fog Lights - lens, housing, bulb, condition, security, operation, clarity   |
| 30                | Side Marker Lights - lens, housing, condition, security, operation, clarity   |
| 31                | Tail Lights - lens, housing, condition, security, operation, clarity  |
| 32                | Turn Signals - engagement operation, blinks properly, turn signal indicator operational, exterior turn signal function                    |
| 33                | Brake Lights/Center Light - lens, housing, condition, security, operation, clarity  |
| 34                | Emergency Road Hazard Lights - switch operation, flasher proper operation, lights lens', housing, condition, security, operation, clarity |
| 35                | Reverse Lights - lens, housing, condition, security, operation, clarity   |
| 36                | License Lights - lens, housing, condition, security, operation, clarity   |
| 37                | Other Lights - lens, housing, condition, security, operation, clarity   |

| INTERIOR—CONDITION |  |
|--------------------|--|
| ID#                | Test Point   |
| 38                 | General Condition/Odors/Mildew - general rips, tears, wear, stains, mold, mildew, water damage, cigar smoke odors,                             |
| 39                 | Interior Modifications - Seats, dash, controls, instruments, air conditioning  |
| 40                 | Headliner - condition, rips, tears, security, hardware   |
| 41                 | Front Seat Cover Condition - rips, tears, stains, wear, fit  |
| 42                 | Rear Seat Cover Condition - rips, tears, stains, wear, fit   |
| 43                 | Seat Belt Condition/Operation - cuts, tears, wear, security, latches, hardware, buckles  |
| 44                 | Headrest Operation/Condition - rips, tears, security, adjustability  |
| 45                 | Front Carpet/Floor Mats Condition - rips, tears, stains, wear, fit   |
| 46                 | Rear Carpet Floor Mats Condition - rips, tears, stains, wear, fit  |
| 47                 | Cargo Carpet Condition - rips, tears, stains, wear, fit  |
| 48                 | Door Sill Plate Condition - dents, dings, scrapes, chrome condition, security  |
| 49                 | Door Trim Panels Condition - rips, tears, wear, security, fit  |
| 50                 | Door Glass Condition/Operation - condition, cracks, chips, bubbles, clarity, security  |
| 51                 | Dashboard Condition - rips, tears, cracks, damage, warped, security  |
| 52                 | Interior Trim Condition - rips, tears, wear, damage, security, fit   |
| 53                 | Airbags Cover Condition/Fault - (if equipped) rips, tears, wear, damage, security, fit, Air Bag light illuminated or not test cycling properly |
| 54                 | Glove Box Operation/Condition - rips, tears, wear, damage, security, fit, operation, latch, striker, hardware                                  |
| 55                 | Spare Tire Condition - operating condition, tread condition, wheel condition, wheel tie down, security   |
| 56                 | Tire/Jack/Tools - presence, security, condition, operational   |
| 57                 | Toolkit Complete (if equipped) - presence, condition, security   |

# 158-Point Road Ready Inspection Details

## INTERIOR—CONVENIENCE & CONTROLS

| ID# | Test Point   |
|-----|--|
| 58  | General Condition - presence, condition, security  |
| 59  | Owners Manuals - presence, condition   |
| 60  | Gearshift Operation - security, operation, gear alignment                                      |
| 61  | Parking Brake Control - security, latches, locks, levers, handles, operation                   |
| 62  | Hood Release Operation - security, latches, locks, levers, handles, operation                  |
| 63  | Tilt Steering Operation - security, latches, locks, levers, handles, operation                 |
| 64  | Seat Position Adjuster Operation - security, latches, locks, levers, knobs, handles, operation |
| 65  | Power Seat Switch/Motor Operation - functionality, damage, condition, security, operation      |
| 66  | Power Window Switch/Motor Operation - functionality, noise, condition, security, operation     |
| 67  | Door Lock/Power Switch Operation - functionality, damage, security, operation                  |
| 68  | Power Mirrors Operation - functionality, noise, security, operation                            |
| 69  | Power Sunroof Operation - functionality, alignment, noise, security, operation                 |
| 70  | Sunvisor Vanity Mirrors - functionality, damage, security, operation                           |
| 71  | Windshield Wiper Control Operation - functionality, damage, security, operation                |
| 72  | Defogger/Defogger Light Operation - operation, grid damage, illumination                       |
| 73  | Horn Operation - function, audible volume, security  |
| 74  | Remote Fuel Door Release - security, latches, locks, levers, handles, operation                |
| 75  | Remote Trunk Release - security, latches, locks, levers, handles, operation                    |
| 76  | Cigarette Lighter Operation - receptacle, element, presence, security, operation               |
| 77  | Remote Key FOB Operation (if equipped) - presence, condition, functions,                       |
| 78  | Alarm - function, audible volume, security, operating manual                                   |

## INTERIOR—INSTRUMENTS/LIGHTING

| ID# | Test Point  |
|-----|---|
| 79  | Gauges - speedometer, tachometer, oil pressure, temperature, amp, voltage for condition, operation                    |
| 80  | Odometer Operation - registers properly and all digits aligned and clearly readable                                   |
| 81  | Dash/Instrument Lighting - illumination, speedometer, gauges as equipped, a/c controls, clock                         |
| 82  | Check Engine Light Operation - if fault detected, proper cycle test operation   |
| 83  | Airbag Warning Light Operation - if fault detected, proper cycle test operation                                       |
| 84  | ABS Warning Light Operation - if fault detected, proper cycle test operation  |
| 85  | Clock Operation - sets and operates properly  |
| 86  | Dome Light Operation - illuminates properly from door jam switches and dome light switch, lens condition, security    |
| 87  | Rear View Mirror/Compass Operation - glass clear, adjusts properly, compass proper operation and illuminated properly |
| 88  | Sunvisor Vanity Lights - illuminates properly from mirror cover switch, lens condition, security                      |
| 89  | Trunk Light Operation - illuminates properly from mercury switch, lens condition, security                            |
| 90  | Warning Lights - Other - if fault detected, proper cycle test operation   |

# 158-Point Road Ready Inspection Details

## INTERIOR—A/C & HEATING

| ID# | Test Point   |
|-----|--|
| 91  | A/C Operation/Temperature - switches engage compressor, blower and proper diverter doors and registers when activated                        |
| 92  | Heater/Defroster Operation/Temperature - switches engage compressor, blower and proper diverter doors and registers when activated           |
| 93  | Climate Control Operation - switches engage compressor, blower and proper diverter doors and registers when activated                        |
| 94  | Blower Speeds/Operation - switches engage blower & operates properly on all speeds, no abnormal blower or diverter door noise when activated |
| 95  | A/C Registers - operate properly, missing deflector vanes, condition, appearance   |
| 96  | Seat Heater/Cooler Operation - switches, blowers, heater elements/blowers operate properly   |

## INTERIOR—RADIO & ENTERTAINMENT

| ID# | Test Point  |
|-----|---|
| 97  | Radio Operation/Controls - radio switches/controls operate properly, no missing knobs or buttons  |
| 98  | Speaker Operation/Condition - operates properly from radio/CD/DVD, speaker sound quality normal at all volumes  |
| 99  | CD/DVD Operation - CD/DVD switches/controls operate properly, player engages and ejects disc properly, no missing knobs or buttons                    |
| 100 | Navigation System Operation - Navigation switches/controls operate properly, no missing knobs or buttons  |
| 101 | Back Up Camera Operation - camera switches/controls operate properly, no missing knobs or buttons, display clear and legible                          |
| 102 | Rear Entertainment System Operation - System switches/controls operate properly, player engages and ejects disc properly, no missing knobs or buttons |

# 158-Point Road Ready Inspection Details

| ENGINE & UNDER-HOOD |   |
|---------------------|---|
| ID#                 | Test Point  |
| 103                 | Engine and Underhood Modifications - Engine, cooling system, steering system, electrical system, etc  |
| 104                 | Hood Release Operation - handle and cable operates smoothly with no binding, hood releases properly when engaged, condition, security   |
| 105                 | Hood Latch Operation - latch, striker, hardware operates smoothly with no binding, hood releases properly when engaged, alignment, condition, security  |
| 106                 | Hood Hinge/Struts Operation - hinges, struts, hardware operates smoothly with no binding, hood raises and holds position properly when lifted, alignment, condition, security   |
| 107                 | Hood Insulation - hood insulation present, security, condition  |
| 108                 | Engine Emissions Placard - Placard present on radiator core support and legible   |
| 109                 | Engine Emissions - Pumps, hoses, valves, hardware for condition, security, operation  |
| 110                 | Battery/Battery Hold Down - no physical damage, cables properly attached, provides sufficient power for vehicle operation at time of inspection, hold down brackets and hardware present and properly secures battery from movement   |
| 111                 | Alternator/Generator - correct style type, security, abnormal noise, operation  |
| 112                 | Engine Wiring - wiring, connectors, clamps for security, proper routing, damage, decay, excessive wear, proper installation, operation  |
| 113                 | Engine Leaks - no oil or coolant seeps, leaks, drips from valve covers, timing covers, oil pans, rear main oil seals, manifolds, oil pressure switches, oil filters, oil lines, oil coolers, coolant recovery tank/line, water pump, thermostat, radiator hoses, heater hoses, and other oil control and cooling system equipment |
| 114                 | Cooling System/Radiator/Cap - radiator, cooling fan, fan clutch, water pump for condition, security, operation  |
| 115                 | Radiator Coolant Condition - radiator and overflow tank clean, coolant is clean with no contaminants, coolant to water mixture appears sufficient   |
| 116                 | Heater Hoses - A/C Hoses Condition - hoses firm to touch, clean with no oil saturation, hose clamps secure with no leaks or signs of previous leakage   |
| 117                 | Drive Belts Condition - V belts and serpentine belts clean of oil and other contamination, no dry rotting, no cracks, proper alignment, no abnormal noise, security, overall condition  |
| 118                 | Air Cleaner/Filter - air box secure and no damage, air filter clean, no engine oil or oil residue in air box indicating engine compression blow by  |
| 119                 | Engine Oil Condition - visual oil check, oil level normal, oil is clean with no sludge or, contamination from water or gas, dipstick clean with no signs of surface rust  |
| 120                 | Engine Oil Sludge - dipstick, oil filler cap and oil filler tube clean with no indication of infrequently changed oil, sludge or burnt oil  |
| 121                 | Transmission Fluid Condition - fluid proper level, dipstick, filler tube clean with no indication of infrequently changed oil, contamination, sludge or burnt oil, oil smells normal, dipstick has no surface rust  |
| 122                 | Power Steering System - pump, hoses, lines, fluid proper level, fluid, dipstick, filler tube for security, operation, no sign of contamination, oil smells normal, no sign or internal rust, no leaks from power steering pump, steering gear box, or steering rack or power steering lines                                       |
| 123                 | Brake Master Cylinder Fluid Check - master cylinder reservoir clean with correct fluid level, fluid has no moisture or contaminants, no signs of condensation or moisture in reservoir  |
| 124                 | Windshield Washer Fluid - quantity, condition   |

# 158-Point Road Ready Inspection Details

| DRIVETRAIN & CHASSIS |  |
|----------------------|--|
| ID#                  | Test Point   |
| 125                  | Chassis/Undercarriage Condition - visual inspection of front and rear suspension system, steering system, exhaust system, fuel tank, fuel lines, transmission/differential cooler lines, brake lines, differential, drive axles, CV boots, drivetrain, for damage, leaks, excessive wear, rust, corrosion an condition, security of all chassis and undercarriage components |
| 126                  | Chassis and Undercarriage Modifications - Suspension, steering, exhaust, drivetrain, fuel system, etc  |
| 127                  | Frame/Unibody Condition - previous structural damage/repair or current damage to frame rails, frame crossmembers, subframe, subframe rails, strut towers, inner fender aprons, unibody radiator core supports, roof pillars, B pillar, door sills, rocker panels, floorpans  |
| 128                  | Exhaust System - mufflers, pipes, hangars, hardware for condition, security  |
| 129                  | Suspension Systems - springs, control arms, ball joints, bushings, hardware for damage, condition, operation   |
| 130                  | Shock Absorbers - shocks, struts, strut towers, hardware for condition security, proper operation  |
| 131                  | Steering Condition - steering, steering racks, arms, rods, idlers, rod ends for condition, security, damage  |
| 132                  | Transmission/Cooler Line Leaks - lines, fittings, coolers for condition, security, proper routing, leaks   |
| 133                  | Brakes - brake backing plates, calipers, lines, hoses for leaks, damage  |
| 134                  | Tire Condition and Tread Depth - size, Manufacturer, condition, tread depth, dry rot cracks, deformities   |
| 135                  | Wheel Condition - general condition, damage, dents, scrapes, dents, bent, warped, trim ring damage, lugnuts presence and condition, security   |
| 136                  | Tire Data Map  |

# 158-Point Road Ready Inspection Details

| TEST DRIVE |   |
|------------|---|
| ID#        | Test Point  |
| 137        | Test Drive Length and Speed - Driven 3-5 Miles, normal operation of engine performance, transmission, differential, brakes, suspension, steering, drive-ability   |
| 138        | Cold/Hot Start Quality - engine engages quickly with normal starter engagement, engine attains idle speed immediately with no abnormal control inputs to sustain idle speed   |
| 139        | Starter Function Quality - starter engages normally under hot and cold conditions with no hesitation, starter drag, abnormal noise, grinding  |
| 140        | Engine Idle Quality - engine attains idle speed immediately with no abnormal control inputs to sustain idle speed, engine idles smoothly with no missing and surging  |
| 141        | Engine Noise/Knocks/Rattles - engine has no knocking, rattling, clicking, tapping or other abnormal noise from pistons, rods, crankshaft, lifters, rocker arms, camshafts, cam followers, timing chains/belts, chain/belt tensioners, or other engine drive component on start-up, idle, acceleration or road speed   |
| 142        | Engine Smokes/Excessive Blow by - engine has no fuel or oil smoke emanating from exhaust on start-up, idle, acceleration, deceleration or road speed, engine has no excessive crankcase pressure emanating from oil filler or crankcase ventilation system, engine has no engine oil or oil residue in engine air filter inlet system                                       |
| 143        | Normal Engine Operating Temperature - engine attains normal operating temperature upon start up, engine maintains normal operating temperature under all idle, and road speed conditions with no overheating or surging engine temperatures   |
| 144        | Engine Acceleration/Power Check - engine accelerates normally with no hesitation, engine missing, engine roughness with sufficient power to maintain constant acceleration as applied   |
| 145        | Exhaust Noise Level - exhaust leaks, acceptable sound level   |
| 146        | Transmission/Clutch Operation - transmission operates normally, upshifts and downshifts smoothly at the appropriate time for acceleration applied with no delayed shift, slipping, jerking, gear grinding, gear hanging or hesitation, clutch engages smoothly and fully disengages engine when clutch applied, no slipping, or abnormal noise upon application             |
| 147        | Transmission Shift/Gears Operate Smoothly - transmission operates normally, upshifts and downshifts smoothly at the appropriate time for acceleration applied with no delayed shift, slipping, jerking, gear grinding, gear hanging or hesitation, clutch engages smoothly and fully disengages engine when clutch applied, no slipping, or abnormal noise upon application |
| 148        | Steering Wheel Centered - steering wheel is properly centered while driving on a straight road with no side to side play while driving  |
| 149        | Steering System Operation - steering operates normally with no feel of looseness, slack, free play, binding, tightness, hanging, abnormal noise   |
| 150        | Vehicle Alignment/Tracking Check - vehicle drives straight with no pulling or wandering left or right at all speeds, vehicle does not pull under acceleration or deceleration, vehicle drive stable under lane changes and road surface changes   |
| 151        | Road Vibration - vehicle has no abnormal road vibration or shaking at all speeds from chassis damage, bad tires, bent wheels or drivetrain damage or abnormal wear and tear   |
| 152        | Tire Noise - vehicle emits no abnormal tire noise at any speed due to irregular tire wear, scalloped tires, improper inflation, or damaged tires  |
| 153        | Suspension and Handling Quality - vehicle drives securely with no abnormal spring or shock bounce, no pulling or wandering left or right at all speeds, vehicle does not pull under acceleration, deceleration, turns, lane changes, and road surface changes   |
| 154        | Brake Operation - brakes engage smoothly with no side pulling, vibration, pulsation, surging, grinding, squealing or other abnormal noise   |
| 155        | Parking Brake Operation - parking brake applies smoothly with no abnormal pressure, brake holds vehicle stationary with no engine load applied and with minor engine load applied   |
| 156        | Speedometer/Odometer Operation - speedometer operates normally and accurately with no needle fluctuations, drive cable noise, odometer registers normally with digits aligned properly  |
| 157        | Wind Noise - vehicle has no abnormal or unusual wind noise at road speed from misaligned windows, doors, weatherstrip damage, abnormal convertible top condition, or body trim security or condition  |
| 158        | Squeaks/Rattles - vehicle has no excessive squeaks or rattles due to security of any vehicle part or component, body trim part, suspension or steering component, undercarriage component security or drivetrain abnormality  |